





Threaded-Body Work Supports

3 function types, with metallic wiper edge, optional contact control single acting, max. operating pressure 500 bar

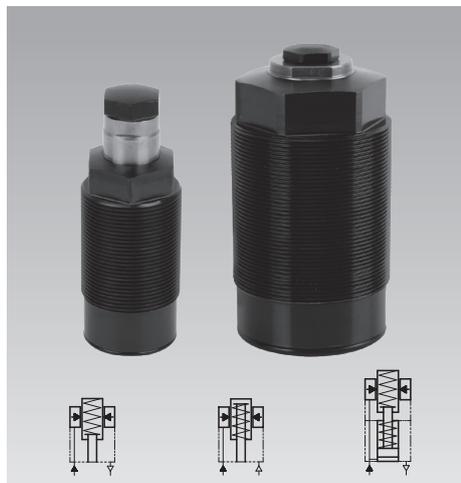

Advantages

- Space-saving threaded-body version
- 4 sizes available
- Load force up to 42 kN
- Workpiece contact by spring force or pneumatically adjustable (type 1941)
- Optional pneumatic contact control
- Metallic wiper edge
- Protected FKM wiper
- Inner parts protected against corrosion
- Venting of the spring area
- Connection of positive air pressure protection possible
- Protection cap available as accessory
- Integrated orifice for flow rate limitation (type 1942)
- Mounting position: any
- Connection of positive air pressure protection up to 4 bar is possible

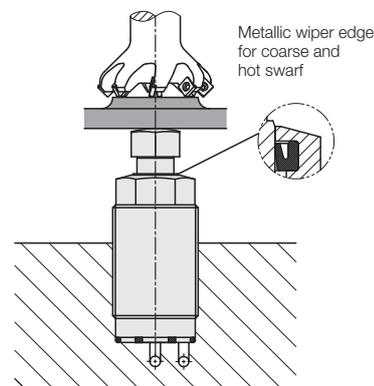

Application

Hydraulic work supports are used to provide a self-adjusting rest for workpieces and avoid their vibration and deflection under machining loads.

The threaded-body design allows for space-saving and direct installation into the fixture body. Hydraulic oil supply and venting are made via drilled channels.

Description

In the body of the threaded-body work supports a thin-walled locking bush is integrated, which locks cylindrically around the freely-movable support plunger when pressurising the element with hydraulic oil.

There are three variations of plunger actuation:

1. Spring force
2. Pneumatically
3. Hydraulically and spring force

The correct contact at the workpiece can be controlled with the optional pneumatic contact control.

The body with metallic wiper edge protects the subjacent FKM wiper against coarse and hot swarf.

Important notes

Work supports are not suitable to compensate side loads. The support plunger must not be stressed by tensile load.

The admissible load force as per diagram is valid for static and dynamic load.

Machining forces can generate vibrations, whose amplitude exceeds far an average value, and this can cause yielding of the support plunger.

Remedy: Increase the safety factor or the number of work supports.


In dry machining applications, with minimum quantity lubrication or in case of accumulation of very small swarf, there can be a swarf hold-up in the area of the metallic wiper edge.

Remedy: Regular cleaning or mount protection cap (see page 2).

Operating conditions, tolerances and other data see data sheet A 0.100.

Installation and connecting possibilities

Drilled channels

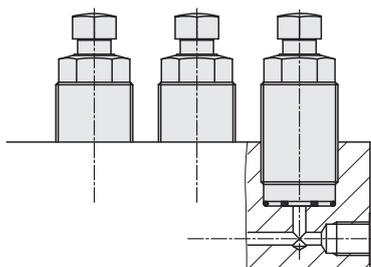

Function

Description on page 2 and page 5.

Pneumatic contact control

Description see page 5.

Combination with clamping elements

With this combination, clamping and machining forces will add up:

$$\begin{aligned} &\text{clamping force} \\ &+ \text{max. machining force} \end{aligned}$$

$$= \text{minimum support force} \times \text{safety factor}$$

Rough calculation from practice:

Required support force $\geq 2 \times$ clamping force

To increase the safety, a support force as high as possible should be achieved

- by using a larger work support or
- by using the max. operating pressure of 500 bar by installing a little intensifier (e.g. data sheet D 8.756), in the supply line of the work supports

Positive air pressure connection




To guarantee functioning of the work supports, a vent port is imperative. No liquids may enter the end of the bore hole (see also data sheet G 0.110 „Venting of the spring area“).

It is recommended to connect positive air pressure protection. While locking the support plunger, the positive air pressure must not exceed 4 bar. If the support plunger is not locked, the positive air pressure must be reduced to a maximum of 0.2 bar.

The positive air pressure connection must be free of oil and water.


Example type 1940XXX

Support plunger in off-position extended

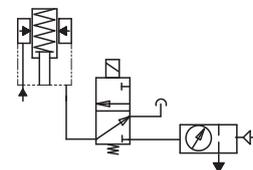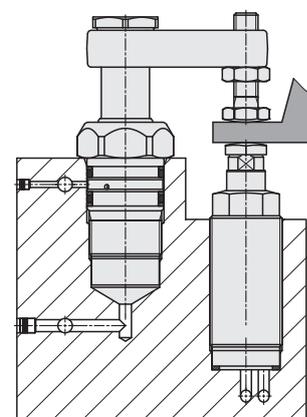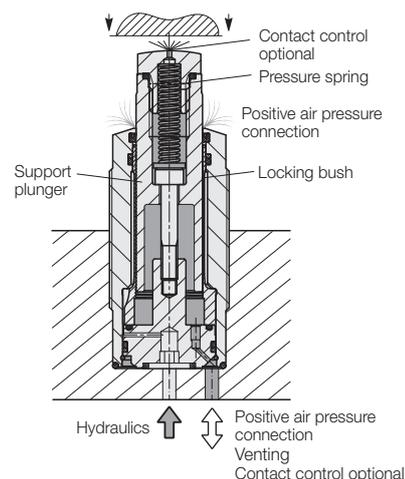

Connection of positive air pressure protection

Spring force
Part no. 1940XXX

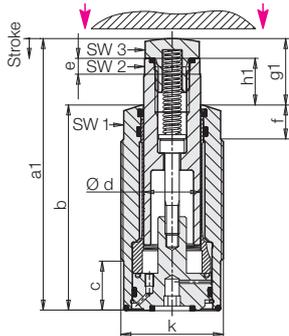


Off-position:
Support plunger extended
Contact by spring force

When inserting the workpiece, the support plunger is pushed back, the spring force has to be overcome (see page 4).

The support plunger will be locked by hydraulic pressure and can compensate forces in axis direction.

After unclamping, the support plunger still contacts the workpiece with spring force, until the workpiece will be unloaded from the fixture.

Porting details

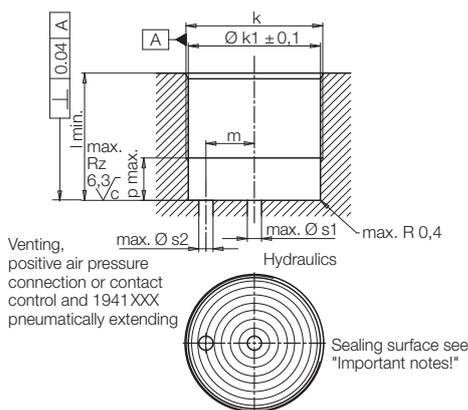

Important notes!
Machining

The code letter c in the surface finish symbol for the sealing surface stands for a concentric groove direction (see drawing), that is given in case of a lowered sealing surface.

In the case of circularly milled surfaces leakages can occur, since the grooves run at right angle to the sealing surface.

Pay attention when mounting:


The location hole must be dry and oil-free to ensure that no liquids penetrate into the spring area of the work supports.

When exchanging work supports:


To get a dry location hole, the hydraulic oil in drilled channels must be removed.

Protection cap (accessories)

The protection cap is fixed by means of the standard contact bolt to the support plunger. It shall be used above all, if a strong coolant jet is directed onto the support plunger or the wiper edge.

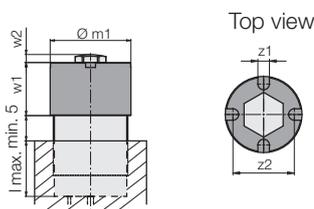

Pneumatically
Part no. 1941XXX

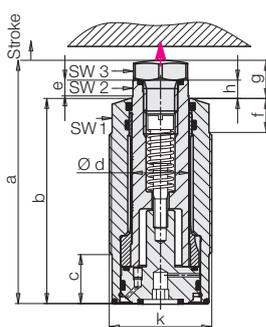


Off-position:
Support plunger retracted
Extend and contact with air pressure

The support plunger contacts the workpiece by air pressure. The contact force is proportional to the air pressure less spring return force (see page 4).


The support plunger will be locked by hydraulic pressure and can compensate forces in axis direction.

For retraction, hydraulic and air pressure will be released and the support plunger retracts by spring force to its off-position.


Adm. load force F as a function of the operating pressure p

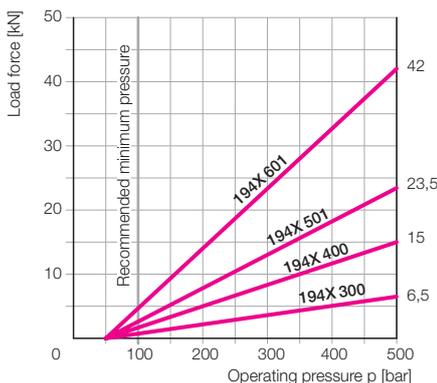

Elastic deformation with load force F and operating pressure 500 bar

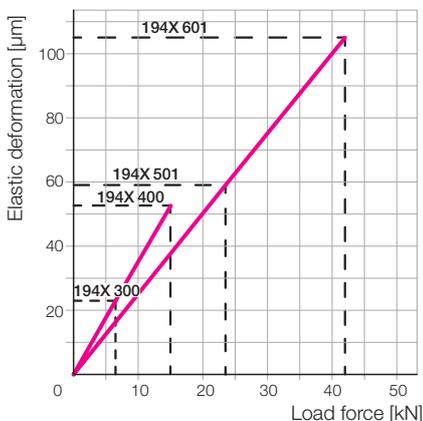

Hydraulically and spring force
Part no. 1942XXX

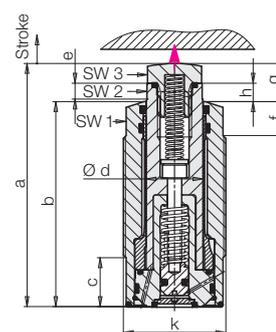


Off-position:
Support plunger retracted
Extend with hydraulics
Contact by spring force

The support plunger is extended by a hydraulically pressurised small piston and contacts the workpiece with spring force.


The support plunger will be locked by increasing hydraulic pressure and can compensate forces in axis direction.

For retraction, the hydraulic pressure will be released. The small piston retracts by spring force to its off-position and also retracts the support plunger.


Required dimensions for self-made contact bolts

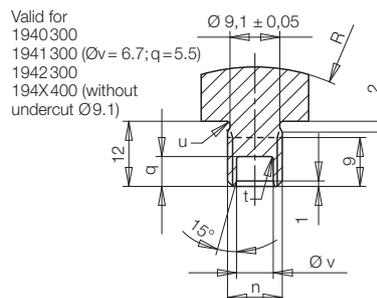


Valid for 194X501

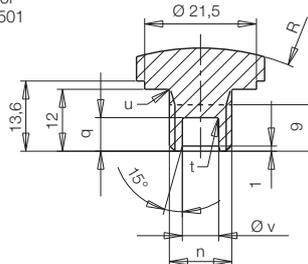

Valid for 194X601

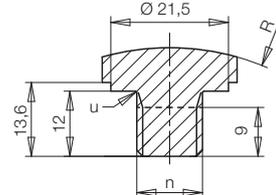

Contact bolt for contact control




Technical data Accessories • Dimensions


Adm. load force (500 bar)	[kN]	6.5		15	23.5	42
Support plunger Ø d	[mm]	16		20	28	32
Stroke	[mm]	8	15	10	10	16
Recommended minimum pressure	[bar]	100		100	100	100
Type						
1940 Spring contact force min./max. Recommended pressure for positive air pressure connection	[N] [bar]	10/13 0.2	– –	14/25 0.2	22/35 0.2	34/64 0.2
1941 Pneumatic contact force at 1 bar minus spring return force min./max.	[N] [N]	20 24.5/35	– –	31.4 19/31	61.5 22/35	80 31/52
1942 Spring contact force min./max. Spring return force min./max. Max. pressure of positive air pressure connection Max. return pressure Required oil per stroke	[N] [N] [bar] [bar] [cm ³]	10/13 19/39 0.2 1 0.5	10/23 16/57 – 1	14/25 30/52 0.2 1 0.8	22/35 47/69 0.2 1 1.54	32/61 67/88 0.2 1 3.22
Elastic deformation with load and 500 bar operating temperature	[µm/kN]	3.5		3.5	2.5	2.5
Operating temperature	[°C]	0 ... 70		0 ... 70	0 ... 70	0 ... 70
Tightening torque	[Nm]	60		100	200	400
a	[mm]	75.5	82.5	86	90	115
a1	[mm]	83.5		96	100	131
b	[mm]	59	66	72.5	78	102.5
c	[mm]	8.5		17.5	20.5	20.5
e	[mm]	6		5.6	3	4
f	[mm]	10.5		12	12	18
g	[mm]	16.5		13.5	12	12.5
g1	[mm]	24.5		23.5	22	28.5
h	[mm]	6.5		6.5	4	4.5
h1	[mm]	14.5		16.5	14	20.5
k	[mm]	M30x1.5		M36x1.5	M48x1.5	M60x1.5
Øk1	[mm]	28.4		34.4	46.4	58.4
l min.	[mm]	21		35	42	46
l max.	[mm]	37.5		49	53.5	65.5
m	[mm]	10		12	17	22
Øm1	[mm]	35		40	52	65
n	[mm]	M10		M12	M12	M12
p max.	[mm]	8		15	18	18
q	[mm]	19		15	6.5	–
Øs1 max.	[mm]	8		10	14	16
Øs2 max.	[mm]	2		4	5	5
t	[mm]	0.5		0.2	0.5	–
u	[mm]	0.6		0.3	0.3	0.3
Øv	[mm]	6		6.9	7	–
w1	[mm]	28		30	30	43
w2	[mm]	10		7	6.4	6.4
z1	[mm]	5		6	8	8
z2	[mm]	28		32	43	53
R	[mm]	35		45	45	45
SW1	[mm]	24		30	41	50
SW2	[mm]	13		17	22	27
SW3	[mm]	17		19	22	22
Weight, approx.	[kg]	0.32	0.35	0.55	1.0	2.3
Part no.						
Contact by spring force		1940 300P	–	1940 400P	1940 501P	1940 601P
Pneumatically extended		1941 300P	–	1941 400P	1941 501P	1941 601P
Hydraulically extended and spring force		1942 300P	1942 305P	1942 400P	1942 501P	1942 601P
		P = Option contact control (see also page 5)				
Accessories						
Protection cap (splash guard)		3546 110		3546 111	3546 112	3546 113
Weight protection cap	[kg]	0.023		0.025	0.032	0.062
Contact bolt for contact control		3614 390		3614 389	3614 391	3614 418
Contact bolt without contact control		3614 330		3614 388	3614 420	3614 419

Contact forces on the workpiece


Spring force Part no. 1940XXX

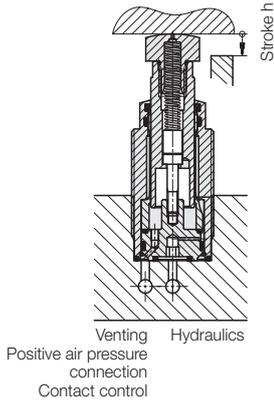

Spring contact force F_{F0} as a function of the stroke of the support plunger h

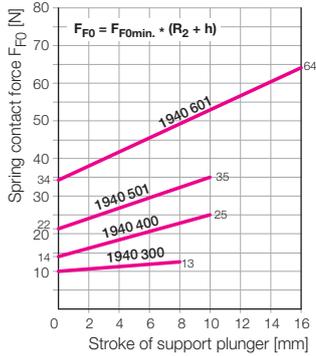

Pneumatic contact forces (F_S , F_P) as a function of the air pressures (p_S , p_A)

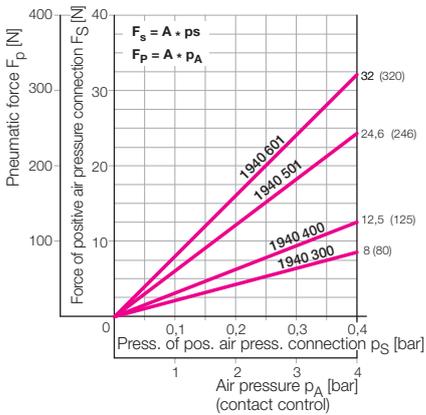

Constant	300	400	501	601
$F_{F0min.}$	10	14	22	34
R_2	0.364	1.103	1.34	1.82
A	20.1	31.4	61.5	80
Weight force*				
Support plunger [N]	0.5	1.3	2.5	3.9
Protection cap [N]	0.23	0.25	0.32	0.62

* For vertical installation: top [-], down [+]. See examples.

Example Work support 1940300
Protection cap 3546 110
Vertical upward installation
Pres. of pos. air pres. con. 0.2 bar
Stroke of support plunger $h = 4$ mm

spring force $F_{F0} = F_{F0min.} + (R_2 \cdot h)$
 $F_{F0} = 10 + (0.364 \cdot 4) = 11.45$ N


+ force of pos. air pres. con. $F_S = A \cdot p_S = 20.1 \cdot 0.2 = 4.02$ N

- weight force support plunger = 0.50 N


- weight force protection cap = 0.23 N

contact force = 14.74 N


Pneumatically Part no. 1941XXX

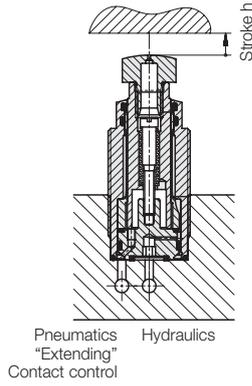

Pneumatic contact force F_P as a function of the air pressure p_A

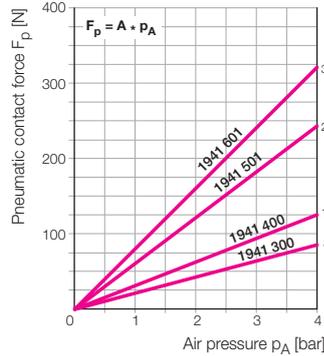

Spring return force F_R as a function of the stroke of the support plunger h

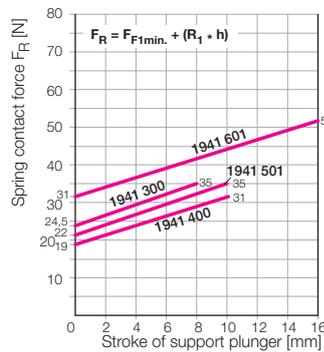

Constant	300	400	501	601
$F_{F1min.}$	24	19	22	31
R_1	1.34	1.26	1.26	1.3
A	20.1	31.4	61.5	80
Weight force*				
Support plunger [N]	0.5	1.3	2.5	3.9
Protection cap [N]	0.23	0.25	0.32	0.62

Example Work support 1941 501
Vertical upward installation
Air pressure 1.5 bar
Stroke of support plunger $h = 7$ mm


pneumatic force $F_P = A \cdot p_A = 61.5 \cdot 1.5 = 92.25$ N

- spring return force F_R
 $F_R = F_{F1min.} + (R_1 \cdot h) = 22 + (1.26 \cdot 7) = 30.82$ N


- weight force support plunger = 2.50 N

contact force = 58.93 N


Spring force Part no. 1942XXX

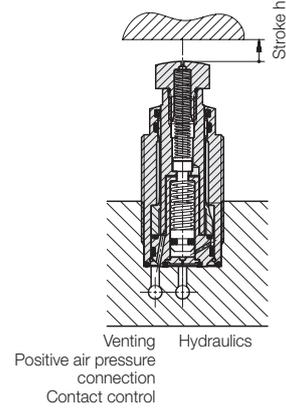

Spring contact force F_{F2} as a function of the stroke of the support plunger h

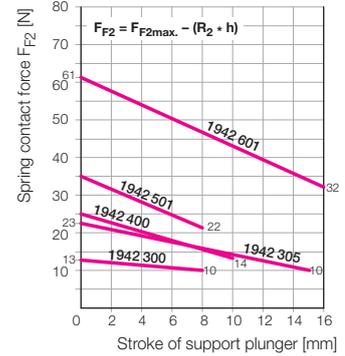

Pneumatic contact forces (F_S , F_P) as a function of the air pressures (p_S , p_A)

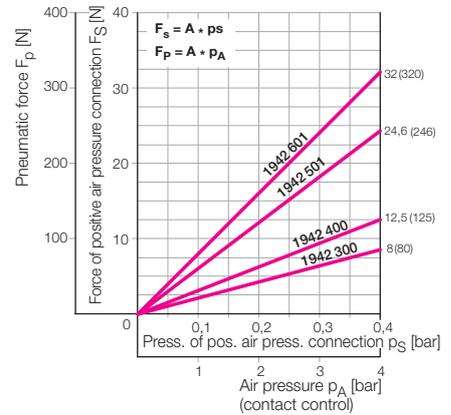

Constant	300	305	400	501	601
$F_{F2max.}$	13	23	25	35	61
R_2	0.364	0.875	1.103	1.34	1.82
A	20.1	20.1	31.4	61.5	80
Weight force*					
Sup. plunger [N]	0.5	0.6	1.3	2.5	3.9
Prot. cap [N]	0.23	0.23	0.25	0.32	0.62

Example Work support 1942400P
Vertical upward installation
Contact control 2 bar
Stroke of support plunger $h = 4$ mm

spring force $F_{F2} = F_{F2max.} - (R_2 \cdot h) = 25 - (1.103 \cdot 4) = 20.58$ N


+ pneumatic contact force F_P
 $F_P = A \cdot p_A = 31.4 \cdot 2 = 62.80$ N

- weight force support plunger = 1.30 N

contact force = 82.08 N

Pneumatic contact control

Function sequence • Signal conversion

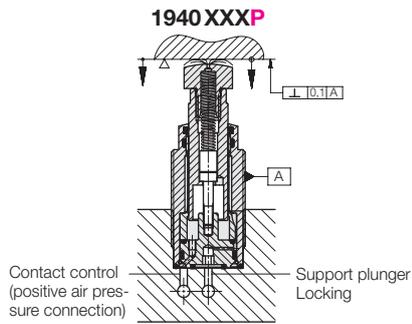

Off-position:
Support plunger extended with spring force.
Positive air pressure connection of 0.2 bar switched on, if required.


Function sequence
Workpiece loading and clamping on fixed points.

Switch on contact control
After the message "support plungers are in contact"
Hydraulic clamping of support plungers.

Machining of the workpiece
Switch off contact control or reduce pressure of positive air pressure connection to 0,2 bar.

Alternative
Leave the contact control continuously switched on.
Advantage:

Acts as a positive air pressure connection.
Disadvantages:
Higher contact force of support plunger
Signals workpiece contact before the workpiece is clamped to fixed points.

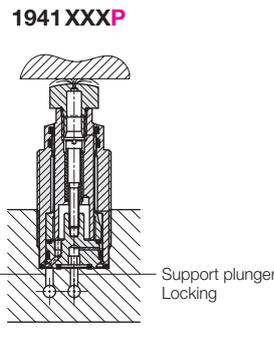

Off-position:
Support plunger retracted with spring force.
Positive air pressure connection of 0.2 bar switched on, if required.


Function sequence
Workpiece loading and clamping on fixed points.

Switch on pneumatic pressure to extend and contact control
Support plungers move pneumatically against the workpiece

After the message "support plungers are in contact"
Hydraulic clamping of support plungers.

Machining of the workpiece
Switch off contact control or reduce pressure of positive air pressure connection to 0,2 bar.

Important note!
Before unclamping, switch off pneumatic pressure and contact control or reduce pressure of positive air pressure connection to 0.2 bar to allow retraction of the support plunger by spring force.

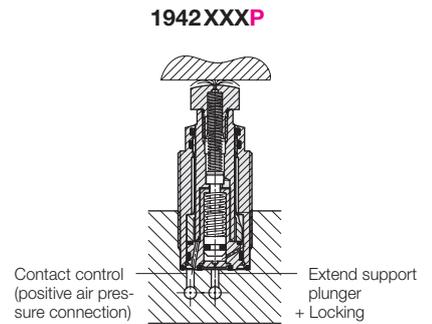

Off-position:
Support plunger retracted with spring force.
Positive air pressure connection of 0.2 bar switched on, if required.

Function sequence
Workpiece loading and clamping on fixed points.

Switch on hydraulics for support plunger
Support plungers extend hydraulically, they are in contact with the workpiece by spring force and are hydraulically locked.

Switch on contact control
After the message "support plungers are in contact"

Machining of the workpiece
Switch off contact control or reduce pressure of positive air pressure connection to 0,2 bar.

Important note!
Before unclamping, switch off pneumatic pressure for contact control or reduce pressure of positive air pressure connection to 0.2 bar to allow retraction of the support plunger by spring force.

Limits of application

The pneumatic contact control can only be used if

- the contact surface at the workpiece is square to the axis of the work support.
- the contact surface is machined.
- the air is free of oil and water.


Signal conversion: pneumatic - electric

If the contact bolt is in contact with the workpiece, the little nozzle will be closed.
An electro-pneumatic measuring device can either measure the pressure increase or a drop of the air flow rate.

1. Pressure switch

Advantage
Easy adjustment.

Disadvantage
When contacting the workpiece, the tightness of the nozzle depends on the surface quality of the contact surface and depending on the workpiece more or less large changes in air pressure are possible. With an increasing number of work supports, the pressure differences will decrease and this makes the process-safe setting of a pressure switch more difficult.

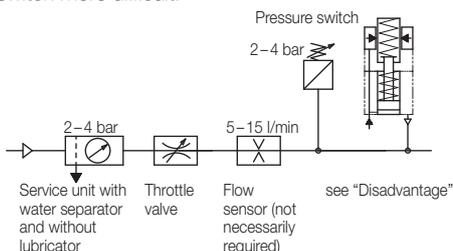


Recommendation
If several work supports have to be controlled, a flow measurement is preferable.

2. Flow meter

The flow meter should have a digital display and at least one adjustable limit switch with a binary output (e.g. type SFAB of FESTO).

Advantages
For the flow measurement, an air pressure of 2 to 4 bar is sufficient so that the support plunger contact force at the workpiece is still relatively low.
Simple adjustment of the switching point:
1. Measure the flow rate (Q_{min}) when all support plungers are in contact with the workpiece.
2. Repeat the measurement if 1 support plunger has no contact (Q_{max}).
3. Enter and save
switching point = $0.5 \times (Q_{min} + Q_{max})$.


Disadvantages
If the difference ($Q_{max} - Q_{min}$) is too small, increase the flow rate or reduce the number of support points per sensor.

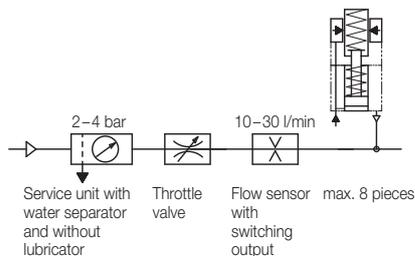

Alternatives
The air gap sensor SOPA from FESTO has an integrated compressed air preparation, as well as two solenoid valves for measuring air and positive air pressure connection.
The device can be expanded to 4 measuring circuits.

Diagram for switching point determination

for flow meters with built-in limit switch as a function of the flow rate and the pneumatic pressure. The curves were determined in the test and apply for the following situation:
"In clamped mode, at least one work support of maximum 8 off is not correctly in contact with the workpiece."

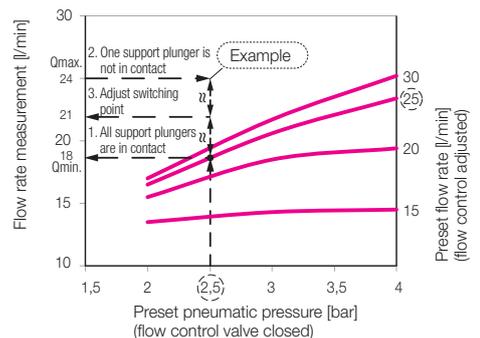

Example 8 work supports 1942 400P
Preset pneumatic pressure 2.5 bar
Preset flow rate 25 l/min

As per diagram:
Flow rate, if all work supports are in contact approx. 18 l/min
Flow rate, if at least one support plunger is not in contact approx. 24 l/min
Switching point = $0.5 \times (18 + 24) = 21$ l/min
The limit switch at the flow meter is adjusted to 21 l/min.

3. Differential pressure switch

Differential pressure switches (e.g. PEL-System) require only 0.5 to 1.5 bar working pressure.
The exact adjustment of a setting nozzle under practical conditions is required.